


Scraper cross slope appears to be the opposite of what it should be.


Symptoms:

When T3RRA is commanding a cross slope tilt to one side the scraper blade is doing the opposite. iGrade is showing a current cross slope % as positive when the implement is rolled to the left, and negative when tolled to the right. Reversing hydraulic hoses in the remotes does not help the problem.

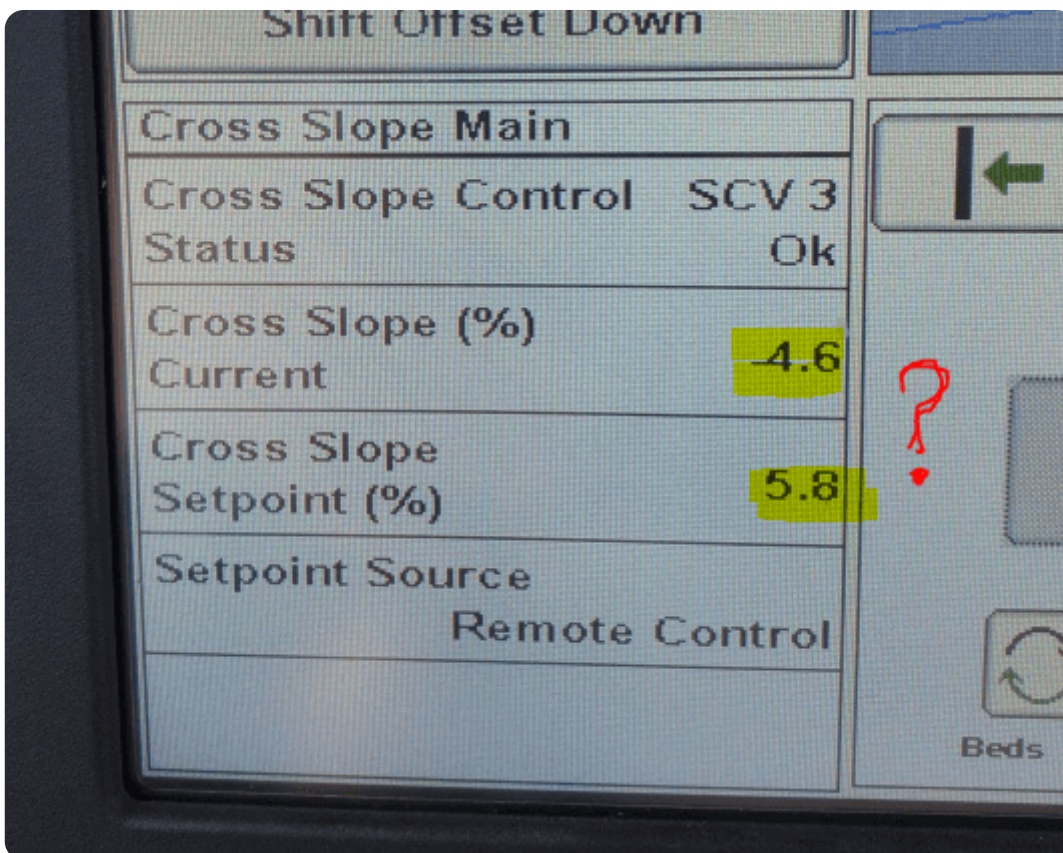

Cause:

The implement GPS mount direction has been changed to 'Backward' in the John Deere display. This causes receiver TCM readings to be the opposite of what they should be.

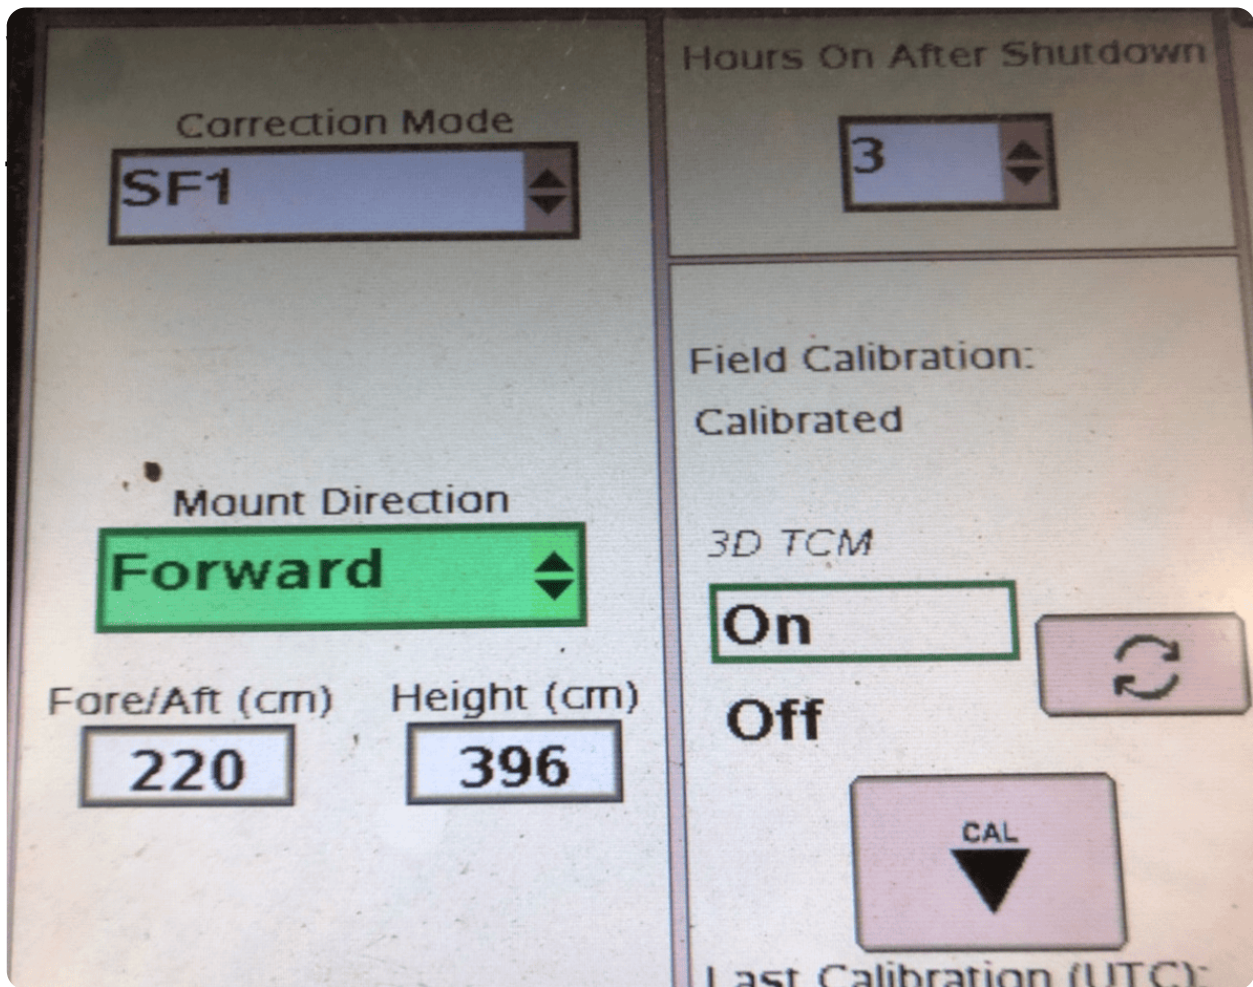

Receiver is